

Service description

Product: SP200	Service description no: 3112-S009	Ver: 1
-------------------	---	-----------

Symptom

Slurry mass comes out of the upper part of the cover tube towards the gearbox.



Caused by

The drainage holes in the cover tube are clogged. The cover tube is full of slurry.

Solution

Flush out drainage holes.



If this does not help, the cover tube is most likely full of dried manure.
Release the set screws on the cover tube.



Loosen the cover tube from the pump housing and from the gearbox housing.
Rinse cleanly inside the cover tube.