

## Service description

Product: SP400	Service description no: 3125-S011	Ver: 1
-------------------	---	-----------

### Symptom


The hydraulic functions of the pump do not work.

### Caused by

The non-return valve, which prevents pressure being applied to the wrong side of the valve block, does not release when oil pressure has been applied to the wrong hose.

### Solution

Remove the hose with the non-return valve from the tractor.

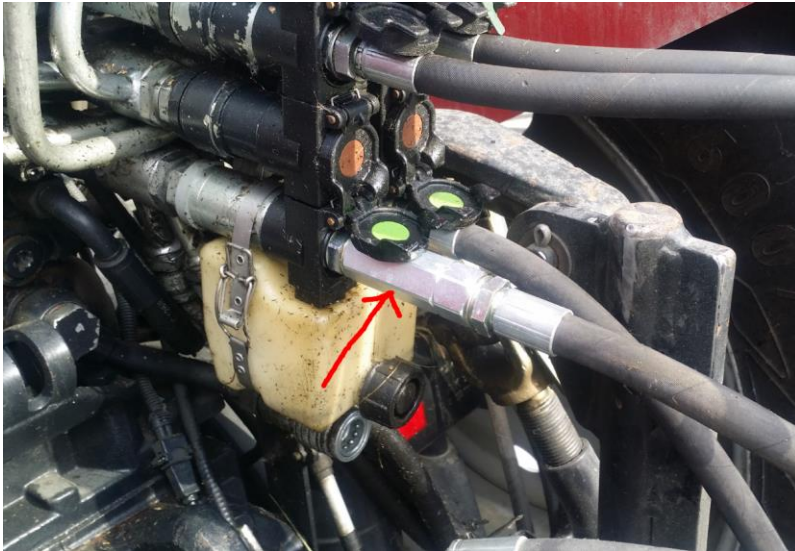

Release the quick coupling from the non-return valve to relieve the oil pressure between them. Screw parts together and try again. If possible, this hose can be routed in a free return section to avoid pressure on this side.

