

Service description

Product: PA20	Service description no: 3221-S001	Ver: 1
------------------	---	-----------

Symptom

Shakes when lowering the mixer with the top strut on the PA20.

Caused by

The non return valve on the top strut opens and closes.

Solution

Insert a restrictor between the hydraulic hoses and a non return valve.

Use 2 pcs. restrictors 12x1 with 1.5 mm opening. One washer per hose.

