

Service description

| | | |
|-------------------|--|-----------|
| Product: VM420 | Service description No.: 4120-S015 | Ver: 1 |
|-------------------|--|-----------|

Symptom

No effect from joy stick movement

Cause

The safety valve for the cover above splitting ram is incorrectly adjusted or does not function properly.

Solution

- Open protection cover above tray for the splitting ram
- Unfasten screws fastening the valve with a sixe 10 key and push the valve upwards till stop position.
- Tighten screws lightly.
- Close protection cover above tray and check that the valve plunger is compresses and that the valve slides downwards till it stops in correct position when the lid is completely closed.
- Tighten screws.

