

Service description

| | | |
|-------------------|---|-----------|
| Product: VM420 | Service description No. 4120-S022 | Ver: 1 |
|-------------------|---|-----------|

Symptom

The hydraulic hose connected to the front of splitting cylinder is damaged

- Valid for seriell No. From and including 09001 to and including No.

Cause

1. The valve impulse arm (red item) is fastened with hexagon head screw allowing to little tolerance between splitting ram body and the hydraulic connection.

Solution

1. Replace the screws with av bracket (A). This increases the tolerance with 5,5mm.

