

Service description

Product: VM370	Service description no: 4131-S004	Ver: 1
-------------------	---	-----------

Symptom

Leakage from hydraulic block 2955419

Caused by

O-ring is not tight and must be replaced.

Solution

Release the hexagon on the plug and insert a new O-ring. 2233028 O-ring 28,2 X 3,0 70NBR
Estimated time consumption is 30 min.

